FAG

Service Info

Change of design to protective dust cover

Part replacement - RIU: 566283.H195 replaced with 566283.01.H195

Manufacturers:	DAF
Wheel hubs OE number:	1657637 1391617 1818003 1812161
Wheel bearing Old part number: New part no.:	 566283.H195 566283.01.H195

During fitment of Repair Insert Unit (RIU) part number 566283.H195, the protective dust cover may become twisted on some wheel hubs.
In the worst case scenario, a twisted protective dust cover may cause a bearing to become obstructed, thereby making it difficult for the wheel hub to turn or prevent it from turning altogether.

For this reason, a modified protective dust cover has been developed (see image 1).

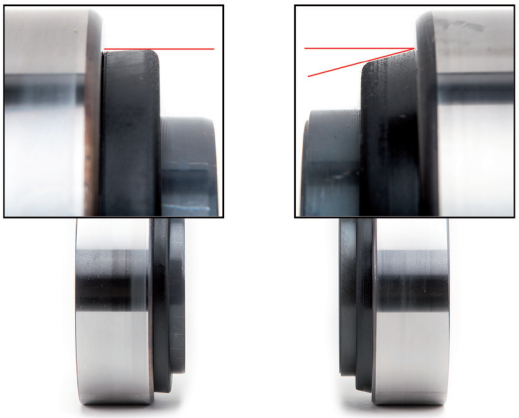

Image 1: The design of the dust-protection cover has been changed

Image 2: New version (566283.01.H195)

As a result of this technical modification, part number 566283.H195 has been replaced with 566283.01.H195.

The vehicle manufacturer has also superseded the affected original equipment wheel hubs. Originally, wheel hubs with the following OE numbers existed: 1657637, 1391617, 1818003, 1812161.
These have now been replaced by numbers 1818003 and 1812161 only.

On both wheel hubs, measurement and installation testing has been performed successfully using the new RIUs.

Please observe the vehicle manufacturer specifications!

You want more? We can help!
Phone: +44 (0) 1432 264 264*
Fax: +44 (0) 1432 375 760
hfd-info@schaeffler.com
www.schaeffler-aftermarket.co.uk
* Calls from within the UK 08457 001100

Issued 11.2014 **FAG 0026** Technical content subject to change
OE Manufacturer's names and numbers are used for reference purposes only
© 2014 Schaeffler Automotive Aftermarket GmbH & Co. KG

LUK INA FAG RUVILLE

SCHAEFFLER AUTOMOTIVE AFTERMARKET